



ASSEMBLY INSTRUCTIONS - 1.0/2.3 CONNECTORS (50 Ohm SERIES) for flexible cable


STRAIGHT CONNECTORS

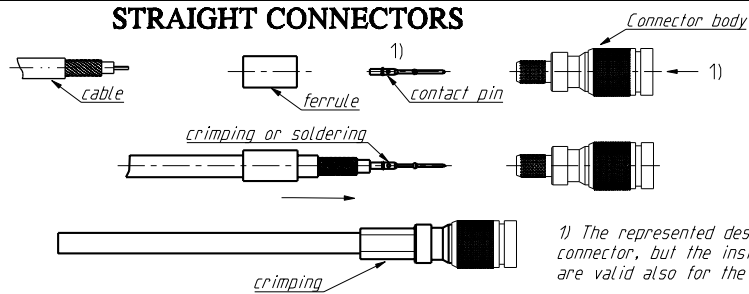

RIGHT ANGLE CONNECTORS

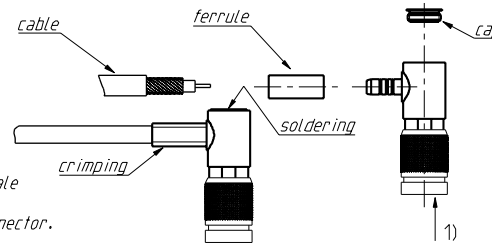

45° ANGLE CONNECTORS

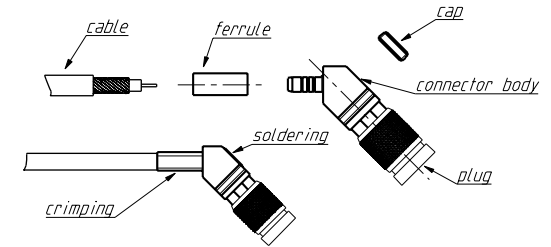

Cable stripping dimensions	Crimp size HEX outer contact	Crimp Length	Crimp size square inner contact	Crimp Length	Connectors types P/N 350.044.XXX	Crimp size HEX outer contact	Crimp Length	Connectors types P/N 350.044.XXX	Crimp size HEX outer contact	Crimp Length	Connectors types P/N 350.044.XXX													
	3.25	8	solder	/	001-008-021-055 020		8	400-409-411-415 402 401-419		8	300-312 311													
	3.4																							
	3.5																							
	3.8																							
	4.06																							
	4.52																							
5.41	0.7	1+1.5	026 009 056 003-023-098 002-005-022-025-054		8	211-212-224-430-455 220-450 456 210-431-432-452-453		8	305 302-336 301-304-329 335															
5.41	solder	/																						
	5.41	8	solder							/	007		8	211-212-224-430-455 220-450 456 210-431-432-452-453		8	337							
		6.5	8							solder								/	027		8	465		
			3.5							8								0.7					1+1.5	070 050
			3.8							1**								2.5					071 **only for ST214 cable soldering for RG58 cable 051	
	6.5	10	solder	/	103-137.1-165T2 166 101 136 102-106-130		8	465																
	6.8								1															
									3.25	8	solder	/	127											
									3.4															
3.5																								
4.52																								
5.41	1	2.5	072																					
	5.41	8		solder	/																			
		6.8	8+10	1	2.5																			

All the dimensions are in millimeters

* Dimension for cutting intermediate layers or ground wires (when present)

ED. N°	DATE	DRAWN/CHECKED
-----	21.09.06	Gb Cv

Part. number : 900.005.302